



# Service Bulletin

File in Section: -

Bulletin No.: PI0312A

Date: March, 2012

## PRELIMINARY INFORMATION

**Subject:** Fluid Leak from Transfer Case (PTU) Vent

**Models:** 2010-2012 Chevrolet Equinox  
 2010-2012 GMC Terrain  
 Equipped with All-Wheel Drive (RPO MHC or MH4)

This PI is being revised to add the 2012 model year and change the U.S. fluid part number. Please discard PI0312.

### Condition/Concern

Some customers may comment on a fluid leak under the front of the vehicle. Further inspection will reveal the leak to be gear oil and show the leak is coming from the transfer case (PTU) vent.

This condition may be caused by the fluid additives breaking down, resulting in fluid being expelled from the vent.

### Recommendation/Instructions

Confirm that the leak is gear oil and is coming from the transfer case vent. If the leak is determined to be coming from the specified area, replace the transfer case fluid. Refer to the Transfer Case Fluid Replacement procedure in SI.

### Parts Information

Part Number	Description	Qty
88900401 (in Canada, use 89021678)	Synthetic Lubricant	1

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
K9813*	Transfer Case Fluid Replacement	0.3 hr

\*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.